

Thank you for purchasing the MUTOH ValueJet printer.

This product can directly print on to thick objects.

When printing on such objects, take extra care to avoid ink mist or splash.

Before use, please read the following instructions and safety precautions.

Important!

Skin contact with uncured UV ink can cause health hazard.

Once UV ink gets on the product and is fully cured, you cannot remove it easily.

If it is cured on moving parts, it can cause damage or failure to the product.

1. Select "Off" in the vacuum fan menu.


If a vacuum fan is not required to hold an object on the table, select "Off" in the vacuum fan menu.

For example:

- when an object can sit stable on the table.
- when using a jig to hold an object stable on the table.

2. Difference in height on the printing area should be less than 2 mm.

When printing on uneven or curved objects, choose an area where the difference in height between highest and lowest points of printing area will be less than 2 mm.

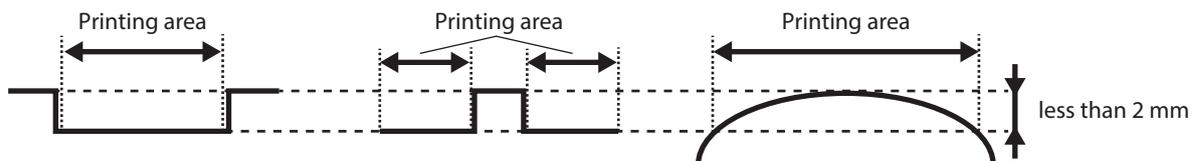

Note

If the printed image looks blurry or fuzzy, check the following settings:

- Head height
- Printing area
- Media placement location

3. Mask non-printing area using jig.

To perform borderless printing or print on a highly curved object, use a jig to mask the area that you do not want to print.



Note

When using a jig, make sure to check the points below:

- Align the height of the jig and printing area of the object. The gap between the jig and printing area should be as small as possible.
- To avoid ink stains on the table, create a jig with the same size as the maximum media size.
(VJ-426UF: (W)483 x (D)329 mm, VJ-626UF: (W)483 x (D)594 mm)
- The total weight of objects and jigs on the table must not exceed the maximum weight allowance:
(VJ-426UF: up to 4 kg, VJ-626UF: up to 6 kg)
- When creating a jig, choose materials that do not reflect UV light. (For example, black surface with matte finish, etc.).